

From : Kornelius Boersma

To : Green Well Westland

Date : Wednesday 22 July 2015

Subject : Well integrity HON-GT-01-S2

Wellbore pressure tests

During the workover operations to plug HON-GT-01-S1 and drill the sidetrack HON-GT-01-S2 two pressure tests have been performed:

1. On the bridgeplug
 - Prior to setting the whipstock and drilling the window.
 - 50 bar/20 mins
 - 1,09 sg brine
 - Figure 1 below
2. On the liner hanger packer
 - After installing the liner w/ screens and setting the liner hanger
 - 50 bar/20 mins
 - 1,09 sg brine
 - Figure 2 below

During the pressure tests the full 9-5/8" casing string and the 7" liner (above respectively the bridgeplug and the liner hanger packer) and the plug/packer have been tested successfully to 50 bar.

With these test the integrity of the wellbore has been confirmed twice, both before drilling the sidetrack and thereafter.

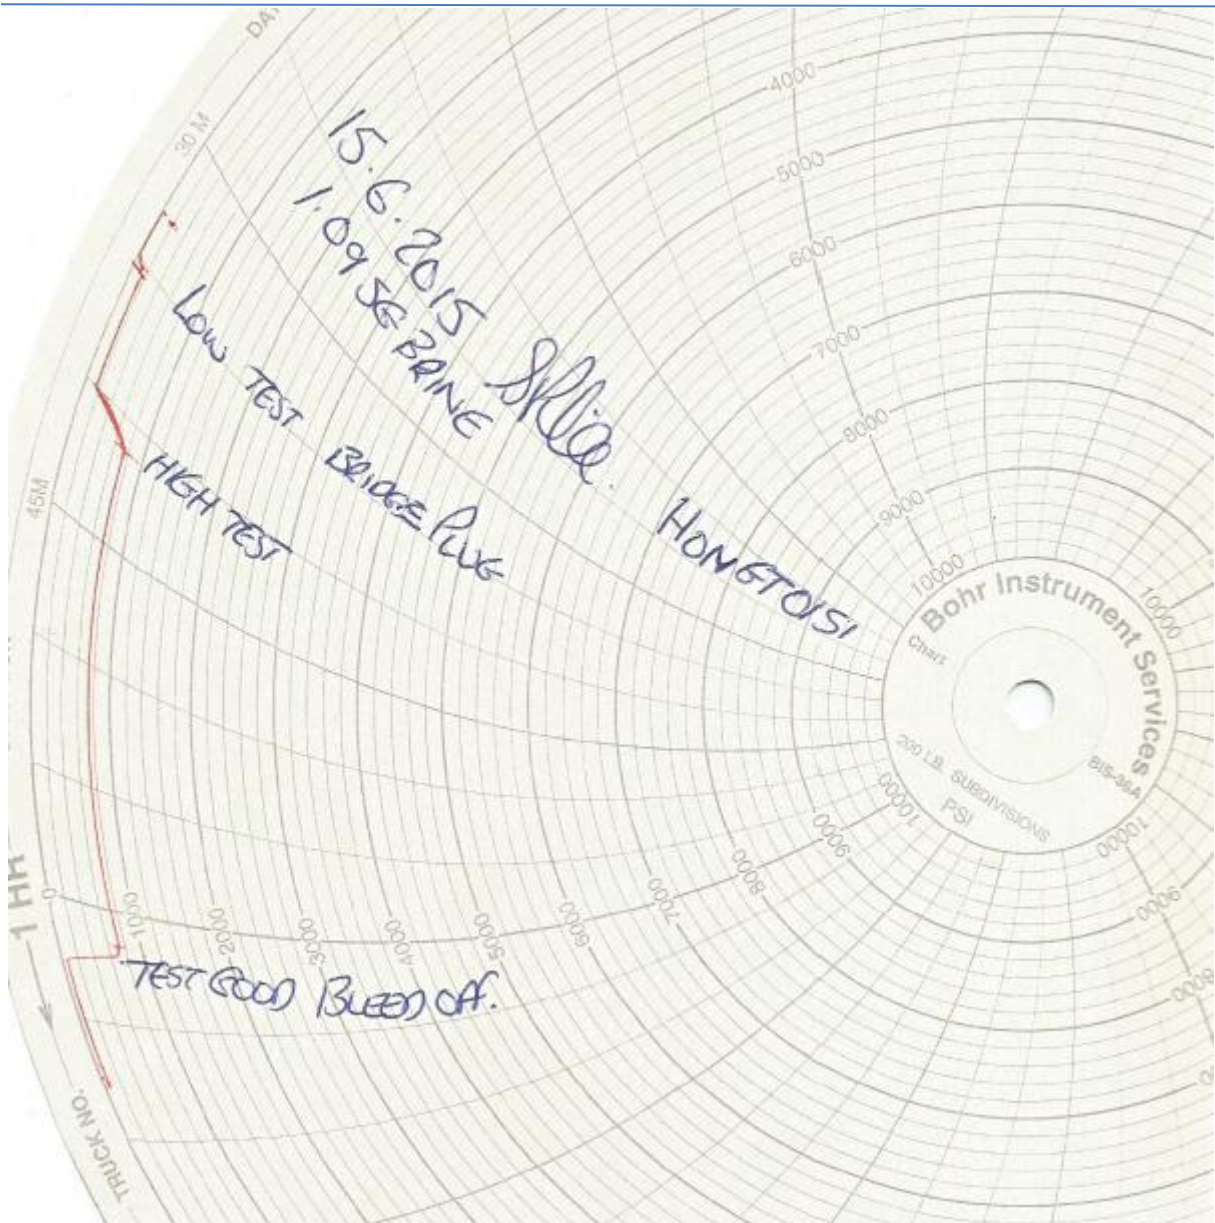


Figure 1: Test chart of Bridgeplug pressure test to 50bar on 15-06-2015

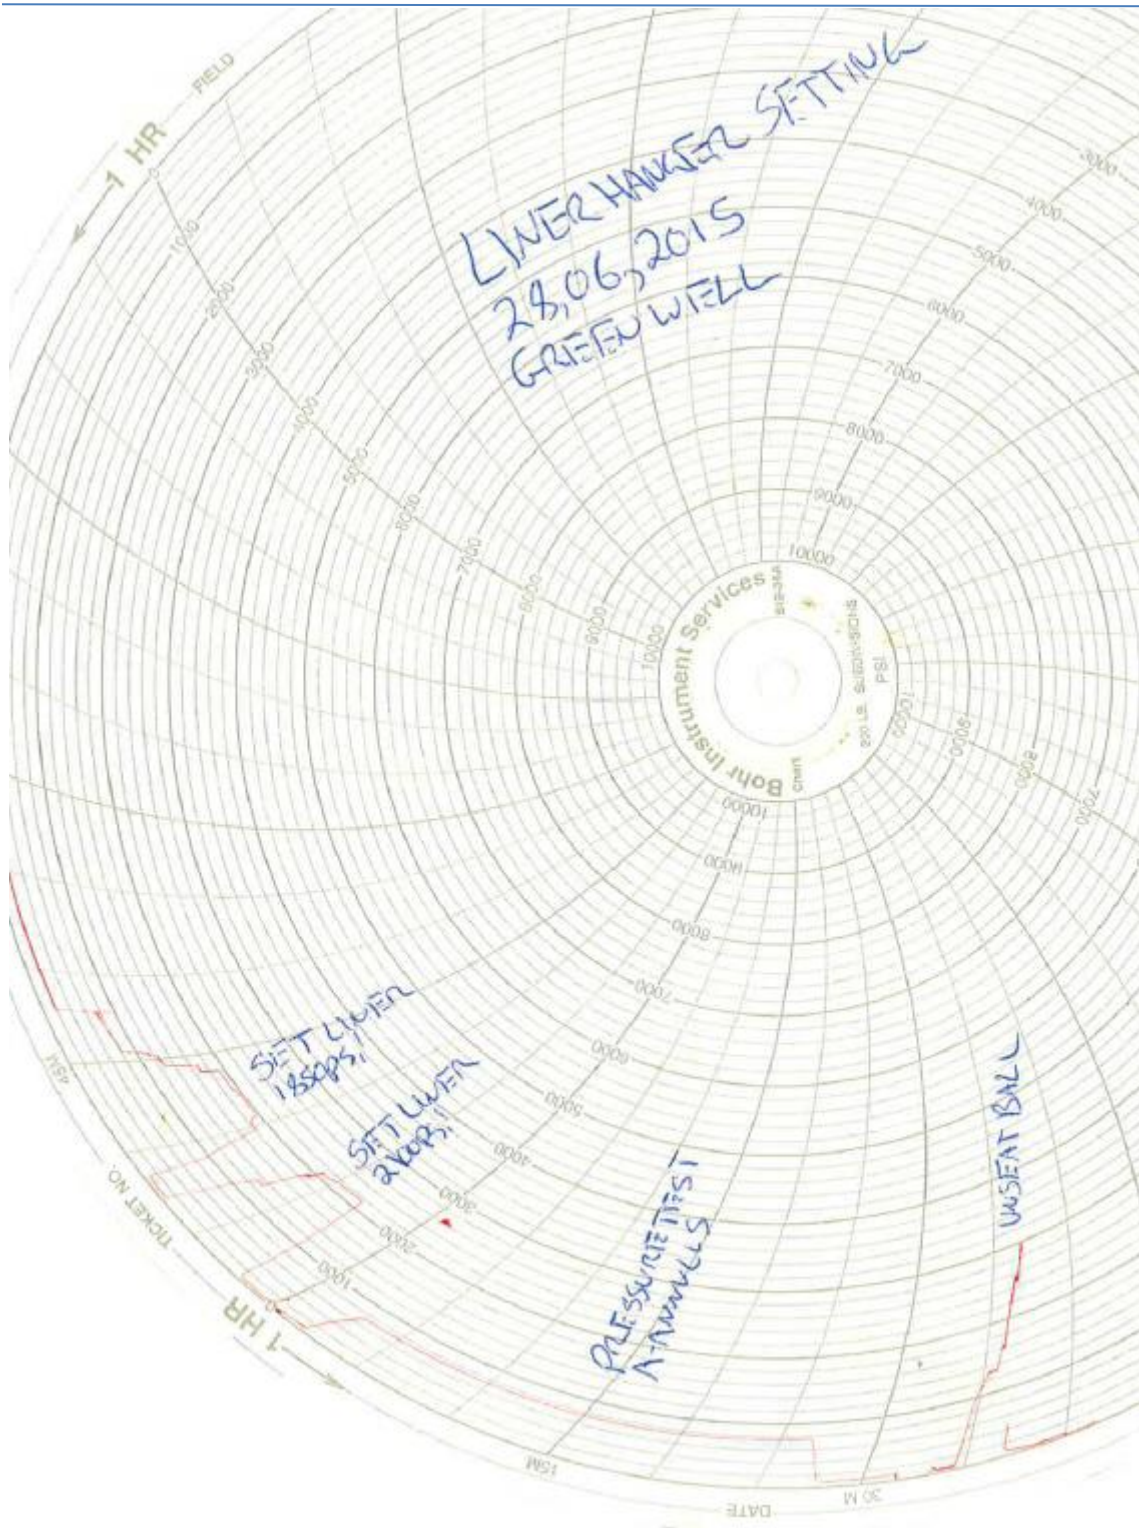


Figure 2: Test chart of Liner hanger packer pressure test to 50bar on 28-06-2015